

## **Fire Alarm Deficiency Notification**

### **24/7 Emergency Service**

- Fire Sprinkler Systems
- Fire Detection & Alarm
- Fire Extinguishers
- Range Hood Systems
- Special Hazard Systems
- Integrated Security Applications
- Healthcare Systems
- Sound & Communications
- Time & Workforce Management
- Emergency Lighting
- System Design & Installation
- Project Management
- Inspection & Testing
- Preventive Maintenance

Over 120 offices in principal cities throughout North America.

Date: 10/04/2013

Name: SouthWest Texas Junior College

Address: 3101 Bob Rogers Drive Egel Pass TX, 78852

Phone: (830) 758-4111

Attention: Gilbert S. Bernea

A SimplexGrinnell technician recently performed a service/inspection on your Life safety systems. Upon completion, your system was Red \_\_\_ / Yellow X tagged for the following deficiencies:

---

Fire panel has two trouble on it. And batteries in building B and Administration building main fire panel need to be replaced. building b batteries 7AH and main fire panel 24AH.

1. Monitor module that monitors troubles from building D is in trouble it will need to be replaced. Model # is Fmm-101 Address # is 1M087
2. Dialer that is located in fire panel is in trouble and will need a service tech to see what will it take to fix and get monitoring from simplexgrinnell.

A SimplexGrinnell representative will be contacting you within the next few days to help you address these deficiencies. If you do not hear from the representative within 5 days of receipt of this notice, then please give me a call.

Respectfully:  
Deficiency Specialist  
SimplexGrinnell  
1070 Arion Crc.  
SanAntonio, TX 78216  
210-402-6311

**THE PER STATE LAW, WE ARE REQUIRED TO NOTIFY THE LOCAL AUTHORITIES WITHIN 24 HOURS OF CONDITIONS LISTED IN THIS LETTER.**

**tyco**

Fire &  
Security

**SimplexGrinnell**

**SimplexGrinnell LP**  
1070 Arion Circle  
Suite 102  
San Antonio, TX 78216  
(210) 402-6311  
(210) 824-6324  
(210) 402-6195 Fax  
www.simplexgrinnell.com

**Inspection Date:10/04/2013**  
**Inspection Frequency: Annual**  
**Inspection Standard: NFPA 72**  
**Signals Verified at Monitoring: NONE**  
**Inspectors Name: Juan C. Barrera**  
**SR #26790190 License No:FAL-6445**

## **FIRE ALARM INSPECTION REPORT**

**Performed in Accordance with Applicable  
National Fire Protection Association Standards**

**Prepared For**

**SouthWest Texas Juoinr Collage**

**3101 Bob Rogers Drive  
Eagle Pass Tx. 78852**

**Gilbert S. Bermea  
Associate Vice-President  
(830) 758-4111**

**BLUE TAG**  **YELLOW TAG**  **RED TAG**

# ***SimplexGrinnell***

## **FIRE ALARM INSPECTION REPORT**

**Performed in Accordance with Applicable  
National Fire Protection Association Standards**

**October 2013 Inspection**

### **PREPARED FOR**

**Gilbert S. Bermea  
Associate Vice-President  
SouthWest Texas Junior College  
4003 Hwy. 277SE  
Eagle Pass, TX 78852  
(830) 758-4111**

**10/04/2013**

**SimplexGrinnell**

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**TABLE OF CONTENTS**

<b>Test Summary</b>	<b>1</b>
<b>Monitoring/Jurisdictional Agencies</b>	<b>2</b>
<b>Test Results - Control Panel/Central Processing Unit</b>	<b>3</b>
<b>Test Results - Alarm Initiating Devices</b>	<b>6</b>
<b>Test Results - Alarm Indicating Devices</b>	<b>11</b>
<b>Test Results - Supervisory Devices</b>	<b>12</b>
<b>Test Results - Control/Auxiliary Devices</b>	<b>13</b>
<b>Inspection Deficiencies Summary</b>	<b>14</b>
<b>Inspection Deficiencies</b>	<b>15</b>

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 1**

**Gilbert S. Bermea  
Associate Vice-President  
SouthWest Texas Junior College  
4003 Hwy. 277SE  
Eagle Pass, TX 78852**

**Thank you for choosing SimplexGrinnell as the provider of your Fire Alarm Inspection services, which began on October 3, 2013, and were completed on October 4, 2013.**

**Fire panel has two trouble on it. And batterys in building B and Administration building main fire panel need to be replaced. building b**

- 1. Monitor module that monitors troubles from building D is in trouble it will need to be replaced. Model # is Fmm-101 Address # is 1M087**
- 2. Dialer that is located in fire panel is in trouble and will need a service tech to see what will it take to fix and get monitoring from simplexgrinnell.**

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 2**

**SITE: SouthWest Texas Junior College**

**Monitoring Agency: NONE**

**Authority Having Jurisdiction: Eagle Pass Fire Department  
Eagle Pass, TX 78852**

**Inspection Service: SimplexGrinnell  
1070 Arion Circle,  
suite 102  
San Antonio, TX 78216  
Phone: (210) 402-6311  
Fax: (210) 402-6192**

**License No.: ACR-2147-K**

**Service Mgr: Al Joly  
Service Sales: Nicole Ritcher  
Inspector: Juan C. Barrera  
Inspector: Bobby Gonzales**

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 3**

**SITE: SouthWest Texas Junior College**

**CONTROL PANEL/CENTRAL PROCESSING UNIT**

**Notifier NFS-640**

**Serial # unk**

**Building: Administration Bldg. Floor: 01 Area: Behind reception area**

<b><u>Test Performed</u></b>	<b><u>Result</u></b>	<b><u>Value</u></b>	<b><u>Notes</u></b>
<b>Voltage w/ Charger</b>	<b>Passed</b>	<b>27.4</b>	
<b>Voltage w/o Charger</b>	<b>Passed</b>	<b>26.3</b>	
<b>Battery % of Charge</b>	<b>Passed</b>	<b>40.0</b>	
<b>Battery Age Check</b>	<b>Failed</b>		<b>Expired Manufacturers Date Code</b>
<b>Control Function(s)</b>	<b>Failed</b>		<b>See Report Comments</b>

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 4**

**SITE: SouthWest Texas Junior College**

**CONTROL PANEL/CENTRAL PROCESSING UNIT**

**Notifier SFP-2404**

**Serial # unk**

**Building: SRRGC Building B Floor: 01 Area: Main office**

<b><u>Test Performed</u></b>	<b><u>Result</u></b>	<b><u>Value</u></b>	<b><u>Notes</u></b>
<b>Voltage w/ Charger</b>	<b>Passed</b>	<b>27.4</b>	
<b>Voltage w/o Charger</b>	<b>Passed</b>	<b>26.3</b>	
<b>Battery % of Charge</b>	<b>Passed</b>	<b>40.0</b>	
<b>Battery Age Check</b>	<b>Failed</b>	<b>8.0</b>	<b>Expired Manufacturers Date Code</b>
<b>Zone Trouble</b>	<b>Passed</b>		
<b>Signal Trouble</b>	<b>Passed</b>		
<b>Type Signal Circuit</b>	<b>Passed</b>		
<b>AC Input Voltage</b>	<b>Passed</b>		
<b>Earth Detection</b>	<b>Passed</b>		
<b>Lamps/LED Test</b>	<b>Passed</b>		
<b>Drill Switch</b>	<b>Passed</b>		
<b>Control Function(s)</b>	<b>Passed</b>		



SimplexGrinnell  
FIRE ALARM INSPECTION REPORT

PAGE 5

SITE: SouthWest Texas Junior College

CONTROL PANEL/CENTRAL PROCESSING UNIT

FireLite MS-5024UD

Serial # unk

Building: SRRGC Building D Floor: 01 Area: Main office

<u>Test Performed</u>	<u>Result</u>	<u>Value</u>	<u>Notes</u>
Voltage w/ Charger	Passed	27.4	
Voltage w/o Charger	Passed	26.3	
Battery % of Charge	Passed	100.0	
Battery Age Check	Passed	1.0	
Zone Trouble	Passed		
Signal Trouble	Passed		
Type Signal Circuit	Passed		
AC Input Voltage	Passed	120.0	
Earth Detection	Passed		
Lamps/LED Test	Passed		
Drill Switch	Passed		
Control Function(s)	Passed		

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INITIATING DEVICES**

**SUMMARY TEST RESULTS**

<u>Dev. Type</u>	<u>Description</u>	<u>Total</u>	<u>Number Tested</u>	<u>Number Failed</u>	<u>Number Not Tested</u>
ADD	Analog Duct Smoke Detector	5	5	0	0
ASD	Analog Smoke Detector	51	51	0	0
HD	Heat Detector	11	11	0	0
PDD	Photo Duct Smoke Detector	7	7	0	0
PSD	Photo Smoke Detector	35	35	0	0
PSDA	Pull Station-Double Action	29	29	0	0

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
ASD	Administration Bldg.	01	Above fire panel			D001	Tested	Passed
ASD	Administration Bldg.	01	Acitivity Directors office			D003	Tested	Passed
ASD	Administration Bldg.	01	Conference room			D023	Tested	Passed
ASD	Administration Bldg.	01	Counselors office			D004	Tested	Passed
ASD	Administration Bldg.	01	Directors office			D014	Tested	Passed
PSDA	Administration Bldg.	01	Exit by counelors			M002	Tested	Passed
ASD	Administration Bldg.	01	Exit by financial Aid			D026	Tested	Passed
PSDA	Administration Bldg.	01	Exit by financial Aid			M006	Tested	Passed
PSDA	Administration Bldg.	01	Exit lounge area			M003	Tested	Passed
ASD	Administration Bldg.	01	Financial Aid room			D025	Tested	Passed
ASD	Administration Bldg.	01	Hall by conference room			D012	Tested	Passed
ASD	Administration Bldg.	01	Hall by womens restroom			D022	Tested	Passed
ASD	Administration Bldg.	01	Janitors closet			D016	Tested	Passed
ASD	Administration Bldg.	01	Lounge area			D015	Tested	Passed
ASD	Administration Bldg.	01	Mens restroom			D020	Tested	Passed
PSDA	Administration Bldg.	01	Min entrance			M001	Tested	Passed
ASD	Administration Bldg.	01	Office manager exit			D010	Tested	Passed
ASD	Administration Bldg.	01	Office manager office			D009	Tested	Passed
ADD	Administration Bldg.	01	Outside Mechanical room AHU-1			D017	Tested	Passed
ADD	Administration Bldg.	01	Outside Mechanical room AHU-2			D019	Tested	Passed
ASD	Administration Bldg.	01	Reception area			D002	Tested	Passed
ASD	Administration Bldg.	01	Storage room by directors office			D013	Tested	Passed
ASD	Administration Bldg.	01	Vault in work room			D005	Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INITIATING DEVICES**

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
ASD	Administration Bldg.	01	Vice presedents office			D011	Tested	Passed
ASD	Administration Bldg.	01	Waiting area			D024	Tested	Passed
ASD	Administration Bldg.	01	Womens restroom			D021	Tested	Passed
ASD	Administration Bldg.	01	Work room			D006	Tested	Passed
ASD	Administration Bldg.	01	Work room closet			D007	Tested	Passed
ASD	Administration Bldg.	01	Work room supplu room			D008	Tested	Passed
HD	Bermea Bldg. A	01	Class room 115			M094	Tested	Passed
PSD	Bermea Bldg. A	01	Class room 115 closet			M093	Tested	Passed
PSDA	Bermea Bldg. A	01	Class room 115 exit			M096	Tested	Passed
HD	Bermea Bldg. A	01	Class room 117			M094	Tested	Passed
PSD	Bermea Bldg. A	01	Class room 117 closet			M093	Tested	Passed
PSDA	Bermea Bldg. A	01	Class room 117 exit			M096	Tested	Passed
PSDA	Bermea Bldg. A	01	Exit by instructors office			M096	Tested	Passed
PSD	Bermea Bldg. A	01	Exit by instructors office			M093	Tested	Passed
PSDA	Bermea Bldg. A	01	Exit corridor by class room 100			M096	Tested	Passed
ASD	Bermea Bldg. A	01	Hall by office #2			D065	Tested	Passed
ASD	Bermea Bldg. A	01	Hall by office #5			D066	Tested	Passed
PDD	Bermea Bldg. A	01	Janitors closet			M095	Tested	Passed
PDD	Bermea Bldg. A	01	Mechanical room			D095	Tested	Passed
PDD	Bermea Bldg. A	01	Mechanical room			D095	Tested	Passed
PSDA	Bermea Bldg. A	01	NorthEast exit			M096	Tested	Passed
PSD	Bermea Bldg. A	01	Science office			M093	Tested	Passed
PSD	Library Building C	01	Classroom C-128			M062	Tested	Passed
PSD	Library Building C	01	Classroom C-135			M062	Tested	Passed
PSD	Library Building C	01	Corridor by room C-121			M062	Tested	Passed
PSD	Library Building C	01	Corridor by room C-127			M062	Tested	Passed
PSD	Library Building C	01	Corridor by room C-132			M062	Tested	Passed
PSDA	Library Building C	01	Exit by room C-111			M060	Tested	Passed
PSDA	Library Building C	01	Exit by room C-113			M060	Tested	Passed
PSDA	Library Building C	01	Exit by room C-118			M060	Tested	Passed
PSDA	Library Building C	01	Exit by room C-120			M060	Tested	Passed
PSDA	Library Building C	01	Exit by room C-128			M060	Tested	Passed
PDD	Library Building C	01	Mechanical room			M063	Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INITIATING DEVICES**

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
PDD	Library Building C	01	Mechanical room			M063	Tested	Passed
PSD	Library Building C	01	Student success center C-132			M062	Tested	Passed
PSD	Library Building C	01	Student success center C-132			M062	Tested	Passed
PSDA	SRRGC Building B	01	Admissions & records			Zn-1	Tested	Passed
PSDA	SRRGC Building B	01	Admissions & records			Zn-1	Tested	Passed
PSDA	SRRGC Building B	01	Exit by mens restroom			Zn-1	Tested	Passed
PSD	SRRGC Building B	01	Janitors closet			Zn-2	Tested	Passed
PSDA	SRRGC Building B	01	Mian entrance			Zn-1	Tested	Passed
PSD	SRRGC Building B	01	Outside Mechnaical room			Zn-2	Tested	Passed
PDD	SRRGC Building B	01	Outside Mechnaical room			Zn-4	Tested	Passed
PDD	SRRGC Building B	01	Outside Mechnaical room			Zn-4	Tested	Passed
PSDA	SRRGC Building B	01	Rear office exit			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-107			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-110			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-111			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-113			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-116			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-117			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-118			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Classroom D-119			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Conference room D-106			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Corridor by main entrance			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Corridor by room D-113			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Corridor by room D-115			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Corridor by room D-116			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Corridor by room D-119			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Corridor by room D-129			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Data room D-115			Zn-2	Tested	Passed
PSDA	SRRGC Building D	01	Exit by room D-107			Zn-5	Tested	Passed
PSDA	SRRGC Building D	01	Exit by room D-113			Zn-4	Tested	Passed
PSDA	SRRGC Building D	01	Exit by room D-129			Zn-5	Tested	Passed
PSD	SRRGC Building D	01	Janitors closet D-102			Zn-2	Tested	Passed
PSDA	SRRGC Building D	01	Main entrance			Zn-5	Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INITIATING DEVICES**

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
PSD	SRRGC Building D	01	Main office room By FACP			Zn-1	Tested	Passed
PSD	SRRGC Building D	01	Outside Mechanical room			Zn-3	Tested	Passed
PSD	SRRGC Building D	01	Resource center D-101			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Room D-112 Thru room D-101			Zn-2	Tested	Passed
PSD	SRRGC Building D	01	Student break room D-105			Zn-1	Tested	Passed
ASD	Tech Building E	01	Classroom E-200			D063	Tested	Passed
ASD	Tech Building E	01	Classroom E-201			D062	Tested	Passed
ASD	Tech Building E	01	Classroom E-202			D058	Tested	Passed
HD	Tech Building E	01	Classroom E-203			D054	Tested	Passed
HD	Tech Building E	01	Classroom E-203			D053	Tested	Passed
HD	Tech Building E	01	Classroom E-203 storage room			D051	Tested	Passed
ASD	Tech Building E	01	Classroom E-204			D050	Tested	Passed
HD	Tech Building E	01	Classroom E-302			D039	Tested	Passed
HD	Tech Building E	01	Classroom E-302			D038	Tested	Passed
HD	Tech Building E	01	Classroom E-302			D037	Tested	Passed
HD	Tech Building E	01	Classroom E-302			D036	Tested	Passed
HD	Tech Building E	01	Classroom E-302			D040	Tested	Passed
ASD	Tech Building E	01	Classroom E-306			D035	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-200			D064	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-204			D061	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-206			D055	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-206 (trouble)			D045	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-300			D029	Tested	Passed
ASD	Tech Building E	01	Corridor by room E-302			D041	Tested	Passed
ASD	Tech Building E	01	Corridor E-200 front exit			D027	Tested	Passed
PSDA	Tech Building E	01	Corridor E200 exit			M013	Tested	Passed
ASD	Tech Building E	01	Data room thru mechanical room			D048	Tested	Passed
PSDA	Tech Building E	01	Exit by room 3-300			M008	Tested	Passed
PSDA	Tech Building E	01	Exit by room E-203			M014	Tested	Passed
PSDA	Tech Building E	01	Exit by room E-206			M015	Tested	Passed
PSDA	Tech Building E	01	Exit door room E-302			M011	Tested	Passed
PSDA	Tech Building E	01	Exit door room E-303			M012	Tested	Passed
ADD	Tech Building E	01	Mechanical room E-200 wing			D072	Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INITIATING DEVICES**

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
ADD	Tech Building E	01	Mechanical room E-200 wing			D071	Tested	Passed
ADD	Tech Building E	01	Mechanical room E-200 wing			D070	Tested	Passed
ASD	Tech Building E	01	Mechanical room E-200 wing			D047	Tested	Passed
ASD	Tech Building E	01	Mechanical room E-300 wing			D033	Tested	Passed
ASD	Tech Building E	01	Mens restroom E-200			D046	Tested	Passed
ASD	Tech Building E	01	Mens restroom E-300			D032	Tested	Passed
ASD	Tech Building E	01	Office E-205A			D060	Tested	Passed
ASD	Tech Building E	01	Office E-205B			D059	Tested	Passed
ASD	Tech Building E	01	Office E-304			D031	Tested	Passed
ASD	Tech Building E	01	Office E-305			D034	Tested	Passed
ASD	Tech Building E	01	Room E-206			D056	Tested	Passed
ASD	Tech Building E	01	Science work room E-203			D052	Tested	Passed
ASD	Tech Building E	01	Storage room Classroom E-202			D057	Tested	Passed
HD	Tech Building E	01	Tool room E-306A/B			D042	Tested	Passed
ASD	Tech Building E	01	Women restroom E-300 wing			D030	Tested	Passed
ASD	Tech Building E	01	Womens restroom E-200			D049	Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**ALARM INDICATING DEVICES**

**SUMMARY TEST RESULTS**

<b>Dev. Type</b>	<b>Description</b>	<b>Total</b>	<b>Number Tested</b>	<b>Number Failed</b>	<b>Number Not Tested</b>
A/V	Audio/Visual Signal Device	6	6	0	0
ANNC	Annunciator	3	3	0	0
VSIG	Visual Only Signal	6	6	0	0

**DETAIL TEST RESULTS**

<b>Dev Type</b>	<b>Building</b>	<b>Floor</b>	<b>Area</b>	<b>Cust Zone</b>	<b>Cust Dev#</b>	<b>Address/ Zone No.</b>	<b>Service Performed</b>	<b>Test Result</b>
A/V	Administration Bldg.	01	100% of all audio visuals				Tested	Passed
VSIG	Administration Bldg.	01	100% of all visuals				Tested	Passed
A/V	Bermea Bldg. A	01	100% of all audio visuals				Tested	Passed
VSIG	Bermea Bldg. A	01	100% of all visuals				Tested	Passed
ANNC	Bermea Bldg. A	01	main entrance				Tested	Passed
A/V	Library Building C	01	100% of all audio visuals				Tested	Passed
VSIG	Library Building C	01	100% of all visuals				Tested	Passed
A/V	SRRGC Building B	01	100% of all audio visuals				Tested	Passed
VSIG	SRRGC Building B	01	100% of all visuals				Tested	Passed
A/V	SRRGC Building D	01	100% of all audio visuals				Tested	Passed
VSIG	SRRGC Building D	01	100% of all visuals				Tested	Passed
ANNC	SRRGC Building D	01	Main entrance				Tested	Passed
A/V	Tech Building E	01	100 % of all Audio visuals				Tested	Passed
VSIG	Tech Building E	01	100% of all visuals				Tested	Passed
ANNC	Tech Building E	01	Main entrance to building				Tested	Passed

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 12**

**SITE: SouthWest Texas Junior College**

**SUPERVISORY DEVICES**

**SUMMARY TEST RESULTS**

<u>Dev. Type</u>	<u>Description</u>	<u>Total</u>	<u>Number Tested</u>	<u>Number Failed</u>	<u>Number Not Tested</u>
DIAL	Telephone Dialer	1	1	1	0

**DETAIL TEST RESULTS**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
DIAL	Administration Bldg.	01	Behind reception in fire panel				Tested	Failed
				See Report Comments				



SimplexGrinnell  
 FIRE ALARM INSPECTION REPORT

SITE: SouthWest Texas Junior College

CONTROL/AUXILIARY DEVICES

SUMMARY TEST RESULTS

<u>Dev. Type</u>	<u>Description</u>	<u>Total</u>	<u>Number Tested</u>	<u>Number Failed</u>	<u>Number Not Tested</u>
AUXC	Auxillary Control	6	6	0	0

DETAIL TEST RESULTS

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
AUXC	Administration Bldg.	01	AHU shut down	ok			Tested	Passed
AUXC	Bermea Bldg. A	01	AHU shut down	ok			Tested	Passed
AUXC	Library Building C	01	AHU shut down	ok			Tested	Passed
AUXC	SRRGC Building B	01	AHU shut down	ok			Tested	Passed
AUXC	SRRGC Building D	01	AHU shut down	ok			Tested	Passed
AUXC	Tech Building E	01	AHU shut down	ok			Tested	Passed

SITE: SouthWest Texas Junior College

**INSPECTION DEFICIENCIES SUMMARY**

**THE FOLLOWING DEFICIENCIES WERE NOTED DURING THIS INSPECTION**

**I. Deficiencies Covered by Your Service Agreement - Corrected by Inspection Team**

None

**II. Deficiencies Covered by Your Service Agreement - Service Call Required**

None

**III. Deficiencies Not Covered by Your Service Agreement**

None

**IV. Deficiencies Identified During This Inspection That Are The Customer's Responsibility**

1	Control Panel-Hard Wired	Failed
1	Control Panel-Multiplex	Failed
1	Telephone Dialer	Failed

Customer Acknowledges responsibility for  
deficiencies listed above

\_\_\_\_\_  
Customer

\_\_\_\_\_  
Date

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**SITE: SouthWest Texas Junior College**

**INSPECTION DEFICIENCIES**

**I. Deficiencies Covered by Your Service Agreement - Corrected by Inspection Team**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
None								

**II. Deficiencies Covered by Your Service Agreement - Service Call Required**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
None								

**III. Deficiencies Not Covered by Your Service Agreement**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
None								


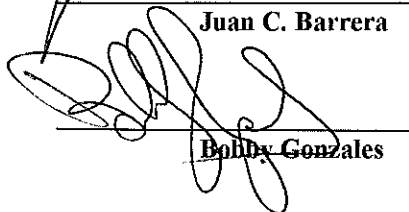
**IV. Deficiencies Identified During This Inspection That Are The Customer's Responsibility**

<u>Dev Type</u>	<u>Building</u>	<u>Floor</u>	<u>Area</u>	<u>Cust Zone</u>	<u>Cust Dev#</u>	<u>Address/ Zone No.</u>	<u>Service Performed</u>	<u>Test Result</u>
CPMX	Administration Bldg.	01	Behind reception area				Tested	Failed
						Expired Manufacturers Date Code See Report Comments		
DIAL	Administration Bldg.	01	Behind reception in fire panel				Tested	Failed
						See Report Comments		
CPHW	SRRGC Building B	01	Main office				Tested	Failed
						Expired Manufacturers Date Code		

**SimplexGrinnell  
FIRE ALARM INSPECTION REPORT**

**PAGE 16**

**SITE: SouthWest Texas Junior College**

<u>Customer</u>	<u>Date</u>
 _____ Juan C. Barrera	<u>10-4-13</u> _____ Date
 _____ Bobby Gonzales	<u>10-4-13</u> _____ Date

**IF YOU HAVE ANY QUESTIONS REGARDING THIS REPORT, PLEASE CONTACT**

**Al Joly Branch Service Manager**

**Phone: (210) 402-6311  
Fax: (210) 402-6192  
Address: 1070 Arion Circle,  
suite 102  
San Antonio, TX 78216**

**26790190.A10**